


cambridge.org/cty

Yoshio Ootaki¹ , Gregory A. Ross² and Kristen A. Zeller³

Images in Congenital Cardiac Disease

Cite this article: Ootaki Y, Ross GA, and Zeller KA (2020) An intra-aortic guide wire: what “knot” to do. *Cardiology in the Young* 30: 273–274. doi: [10.1017/S1047951119002907](https://doi.org/10.1017/S1047951119002907)

Received: 7 November 2019
Accepted: 11 November 2019
First published online: 9 December 2019

Keywords:
Guide wire; knot; entrapment

Author for correspondence:
Y. Ootaki (Ootaki), Department of Cardiothoracic Surgery, Wake Forest Baptist Health, Medical Center Boulevard, Winston-Salem, NC 27157, USA. Tel: +1 336 716 1380; Fax: +1 336 716 1295; E-mail: yotaki@wakehealth.edu

¹Department of Cardiothoracic Surgery, Wake Forest Baptist Health, Winston-Salem, NC, USA; ²Department of Anesthesiology, Wake Forest Baptist Health, Winston-Salem, NC, USA and ³Department of Surgery, Wake Forest Baptist Health, Winston-Salem, NC, USA

Abstract

We report a rare complication of central venous catheter placement in a 5-month-old baby.

A 5-month-old baby was referred to our hospital due to status epilepticus with hemispherectomy. He was intubated due to increasing seizure activity. Placement of a central venous line via a right subclavian approach was attempted using the landmark technique. Following insertion of the guide wire, we attempted to advance a catheter over the guide wire. The catheter was unable to be advanced due to resistance and was removed. We encountered difficulty removing the guide wire, reluctant to use excessive force due to the risk of tearing the vessel. A bedside X-ray showed a kinked or knotted guide wire at the level of the right clavicular head and interval collapse of the right upper lobe (Fig 1). Hence, it was decided to remove the guide wire surgically as well as place a secure central venous line.

A Broviac catheter was inserted into the left subclavian vein under fluoroscopy before exploration of the right subclavian guide wire. Through a subclavicular incision, the guide wire was

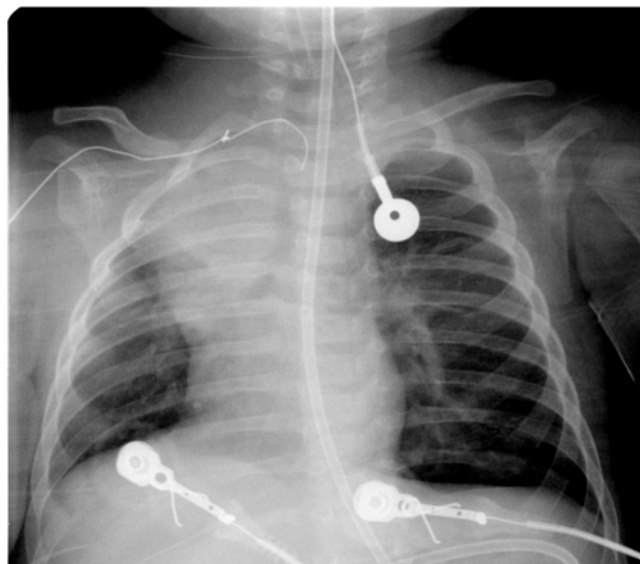


Figure 1. A bedside chest X-ray.

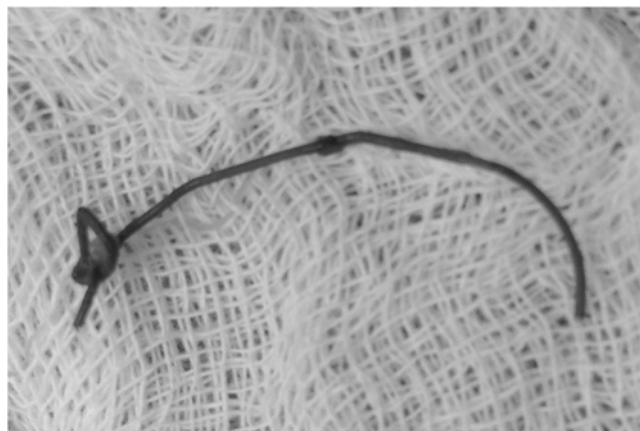


Figure 2. Removed guide wire.

© Cambridge University Press 2019.

CAMBRIDGE
UNIVERSITY PRESS

found to have passed through the subclavian vein just distal to its confluence with the jugular vein. It exited the back wall of the subclavian vein and entered the innominate artery. A venotomy and arteriotomy were required to extract the guide wire from the vessels without significant bleeding (Fig 2). The patient underwent hemispherectomy on day 2 and went home on day 19 postoperatively.

This event and accompanying images represent a rare complication of central venous catheter placement and highlight the risks involved in placing central venous catheters.

Acknowledgements. None.

Financial Support. This research received no specific grant from any funding agency, commercial, or not-for-profit sectors.

Conflicts of Interest. None.

Ethical Standards. The research does not involve human and/or animal experimentation.